




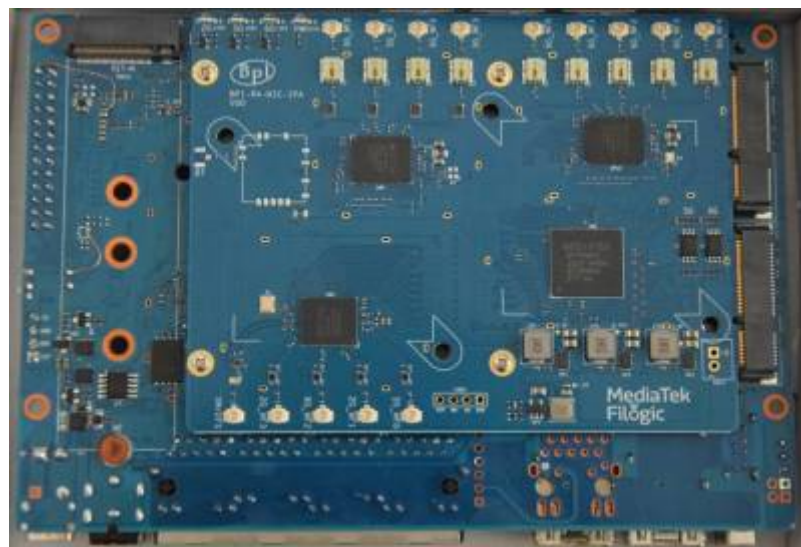

v1.0:

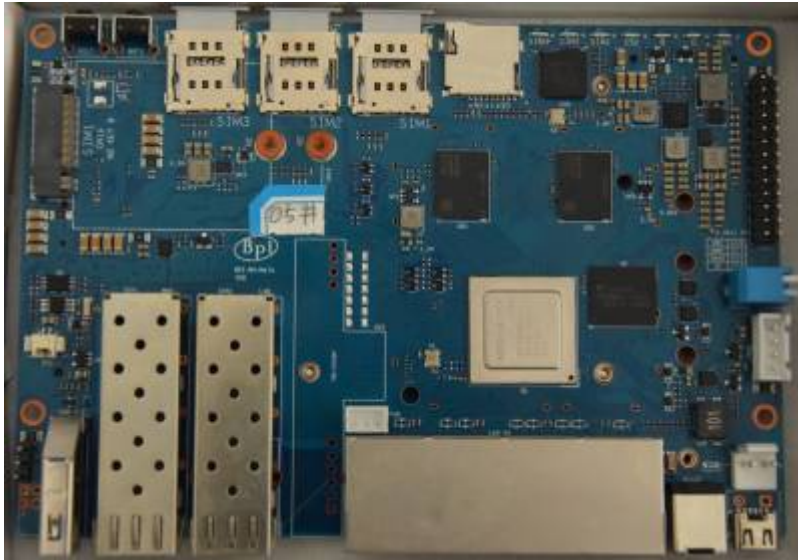

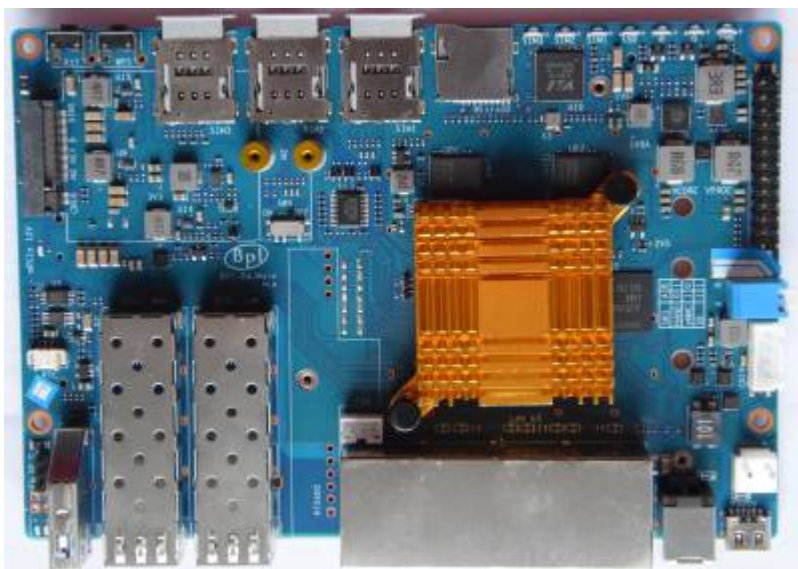

Changes between v0 and v1 (pm): <https://forum.banana-pi.org/t/bpi-r4-linux-bootup/15926/59>

v1.1:



Network

GMAC0 (4Gbit/s) is connected internally to mt7530 switch variant where the 4 user-Ports are exposed as rj45 on board (1xWan,3xLan).

The SFP(+) cages are connected to SerDes lanes of GMAC1 and GMAC2, and those can be switched between SGMII/1000Base-X/2500Base-X mode for 10M/100M/1000M/2500M (via mtk-pcs-lynxi, just like on MT7622 and MT7986) and USXGMII/10GBase-KR for 5000M and 10000M. Hence it should be possible to support both, SFP modules with 1000M and 2500M, as well as SFP+ modules with 5000M and 10000M.

Sfp-connections

USB-A	SFP1-WAN	SFP2-LAN	4xRJ-45	12V	USB-C
	USXGMII0	USXGMII1	GSW		
	eth2	eth1	eth0		

pm: <https://forum.banana-pi.org/t/bpi-r4-linux-bootup/15926/101> (changed interface-names because eth2 is wan-sfp)

full 10G will need RSS+LRO implemented in mtk ethernet driver and enabled (not yet working):

```
ethtool -K eth2 lro on # enable hw_lro
ethtool -k eth2 | grep large
large-receive-offload: on
iperf3 -bidir -c 192.168.90.10
```

RSS:
<https://git01.mediatek.com/plugins/gitiles/openwrt/feeds/mtk-openwrt-feeds/+18f46a84d87308a4f56f9176ca166dc75c38bb20%5E%21/> LRO:
<https://git01.mediatek.com/plugins/gitiles/openwrt/feeds/mtk-openwrt-feeds/+ddc366751fad05dade79b09932a999c5d5ae890c%5E%21/#F0>


NETSYS: V2 for mt7986 (bpi-r3) V3 for mt7988 (bpi-r4)

Wifi

wifi is realized with daughter board (Network Interface Card) in the 2 mPCIe-Slots at bottom of the board.

Wifi-Module needs 12V...v1 uses sw4 in on-position, v0 used devicetree-overlay which enables the WIFI_PWR_EN regulator. Be careful with this setting when using different card in mPCIe slots!

kernel-module: mt7996e.ko

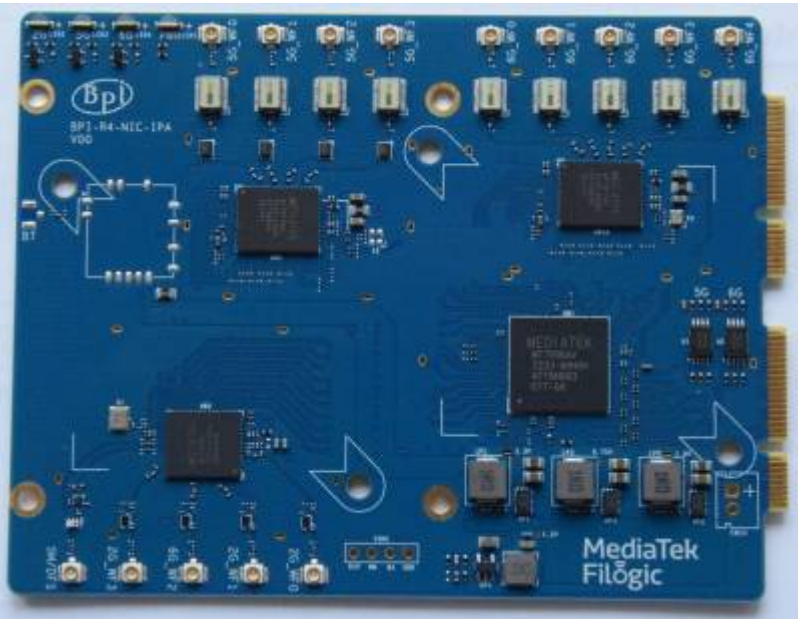



Newer wifi card with reduced antenna-count (6 instead of 14):

<https://forum.banana-pi.org/t/banana-pi-bpi-r4-bpi-be14-wi-fi7-nic-module/17182>

newer card currently has timeout on 3rd wifi interface (6.8-netnext), i guess we need another firmware file for the mt7977ia frontend

PCIE

2x1Lane (M.2 slots) and 2x2lane. the 2x2lane is for wifi (mPCIe slots).

USB

Bootswitch

	A	B
nand	0	1
eMMC	1	0
SD	1	1

switch down is „1“, so both down booting from sdcard (v0 had both up to boot from sdcard)

v0:

1. both switches up ⇒ sdcard
 2. down (1),up (0) seems to be nand as this have mtd command
 3. up(0),down(1) also boots into bpis bootmenu, but i have no mtd command, so i guess this is the emmc
 4. both down failed

COM2		COM2	
HEADER-DIPx19-254-MALE		HEADER-DIPx19-254-MALE	
HEADER-DIPx19-254-MALE		HEADER-DIPx19-254-MALE	
GPIO18_2C_1_SDA	3.3VDD	1	2
GPIO17_2C_1_SCL	3.3V	3	4
GPIO62_JTAG_TMS_NTRST	5.0V	5	6
	5.0V	7	8
	5.0V	9	10
GPIO1_UART1_TXD	5.0V	11	12
GPIO10_UART1_RXD	5.0V	13	14
GPIO9_PCM_FS_LB_LCLK	5.0V	15	16
	5.0V	17	18
GPIO30_SPI_MISO	5.0V	19	20
GPIO29_SPI_MISO	5.0V	21	22
GPIO31_SPI_CLK	5.0V	23	24
	5.0V	25	26

Printed on 2024/05/20 00:20

```
1 file(s), 2 dir(s)
```

```
BPI-R4> fatload usb 0:1 0x50000000 r4/openwrt-mediatek-filogic-bananapi_bpi-  
r4-initramfs-recovery.itb  
7929856 bytes read in 672 ms (11.3 MiB/s)  
BPI-R4> bootm 0x50000000#config-mt7988a-bananapi-bpi-r4#mt7988a-bananapi-  
bpi-r4-sd
```

to get the bootconfigs (after #) we can use dumpimage from uboot-tools, see
https://www.gibbard.me/linux_fit_images/

linux

<https://www.kernel.org/doc/html/v6.1/admin-guide/kernel-parameters.html>

3GB Ram limit not needed anymore as ethernet driver now uses 36bit addressing

Currently we need to limit ram to 3G because of swiotlb buffer full issues in ethernet driver (32bit border)

```
mem=3G
```

in cmdline (bootopts in my uboot uEnv.txt)

kernel

<https://github.com/frank-w/BPI-Router-Linux/tree/6.6-dango>

debug

```
# mount -t debugfs none /sys/kernel/debug/  
# cat /sys/kernel/debug/gpio  
# cat /sys/kernel/debug/pinctrl/pinctrl-handles  
# cat /sys/kernel/debug/regulator/regulator_summary  
# cat /sys/kernel/debug/clk/clk_summary  
  
#enable debug for driver probe  
# echo 'file dd.c +p'>/sys/kernel/debug/dynamic_debug/control  
# echo 'file core.c +p'>/sys/kernel/debug/dynamic_debug/control  
  
# echo '11230000.mmc' > /sys/bus/platform/drivers/mtk-msdc/unbind  
# echo '11230000.mmc' > /sys/bus/platform/drivers/mtk-msdc/bind
```

interface config

```
ip link set lan0 up
ip a a 192.168.0.19/24 dev lan0
ip r a default via 192.168.0.10
date -s "2023-08-23 19:37 CEST"
#stats
ip -s link show dev eth2
ethtool -S eth2
```

DNS needs to be set in /etc/resolv.conf or in systemd like this:

```
mkdir -p /etc/systemd/resolved.conf.d/
cp /etc/systemd/resolved.conf /etc/systemd/resolved.conf.d/TEST.conf
echo "DNS = 192.168.0.10" >> /etc/systemd/resolved.conf.d/TEST.conf
systemctl restart systemd-resolved.service
```

modules in initrd:

```
mount /dev/mmcblk0p6 /mnt
mkdir /lib/modules
mkdir /lib/firmware
mount -o bind /mnt/lib/modules /lib/modules
mount -o bind /mnt/lib/firmware /lib/firmware
modprobe mt7996e
```

openwrt

- clone openwrt master
- add this to feeds.conf.default: "src-git mtksdk
<https://git01.mediatek.com/openwrt/feeds/mtk-openwrt-feeds>"
- scripts/feeds update -f mtksdk
- make menuconfig:
 - Target System (MediaTek Ralink ARM)
 - Subtarget (Filologic 8x0 (MT798x))
 - Target Profile (MediaTek MT7988a nand rfb) #here i see no sd-variant

adding additional options:

```
CONFIG_PACKAGE_f2fs-tools=y
CONFIG_PACKAGE_e2fsprogs=y
CONFIG_PACKAGE_dosfstools=y
CONFIG_PACKAGE_resize2fs=y
CONFIG_PACKAGE_nano=y
CONFIG_PACKAGE_iperf3=y
#CONFIG_PACKAGE_netcat
CONFIG_PACKAGE_tcpdump=y
CONFIG_BUSYBOX_CUSTOM=y
```



```
CONFIG_BUSYBOX_CONFIG_TELNET=y
```

*-initramfs-kernel.bin is not the production image we're using. We only use it for testing purpose since it contains rootfs and won't read the flash.
*-sysupgrade.bin is the actual production image. It's a tar ball for nand/emmc/sd boards. It contains separate kernel and rootfs that will be written to ubi volume for nand, or the partitions defined for sd/emmc.

```
tar -xf bin/targets/mediatek/filogic/openwrt-mediatek-filogic-  
mediatek_mt7988a-rfb-nand-squashfs-sysupgrade.bin sysupgrade-  
mediatek_mt7988a-rfb-nand/kernel  
dumpimage -l sysupgrade-mediatek_mt7988a-rfb-nand/kernel
```

Known Issues

* Card in M.2 slot causes i2c issues (sfp not detected):

<https://forum.banana-pi.org/t/bpi-r4-nvme-i2c/17152/2> * offloading broken with 4G RAM

<https://forum.banana-pi.org/t/banana-pi-bpi-r4-wifi-7-router-board-with-mediatek-mt7988a-filogic-880-4g-ram-and-8g-emmc/15757/247> (limit ram to 2G fixes it)

From:

<http://fw-web.de/dokuwiki/> - **FW-WEB Wiki**

Permanent link:

<http://fw-web.de/dokuwiki/doku.php?id=en:bpi-r4:start&rev=1708163304>

Last update: **2024/02/17 10:48**

